

# Walker Fraser Steele Chartered Surveyors

162 STANMORE ROAD  
GLASGOW  
G42 9AP



# Energy Performance Certificate



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

162 STANMORE ROAD, GLASGOW, G42 9AP

**Dwelling type:** Mid-terrace house  
**Date of assessment:** 12 June 2024  
**Date of certificate:** 15 June 2024  
**Total floor area:** 58 m<sup>2</sup>  
**Primary Energy Indicator:** 253 kWh/m<sup>2</sup>/year


**Reference number:** 9825-1019-1206-7204-8204  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** ECMK  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,276	See your recommendations report for more information
Over 3 years you could save*	£816	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

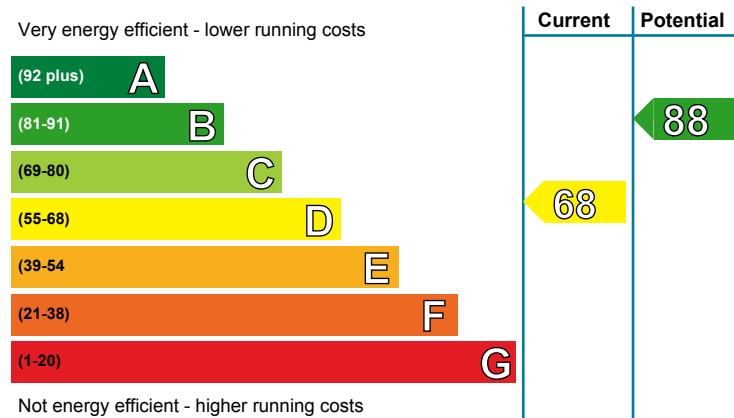


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (68)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

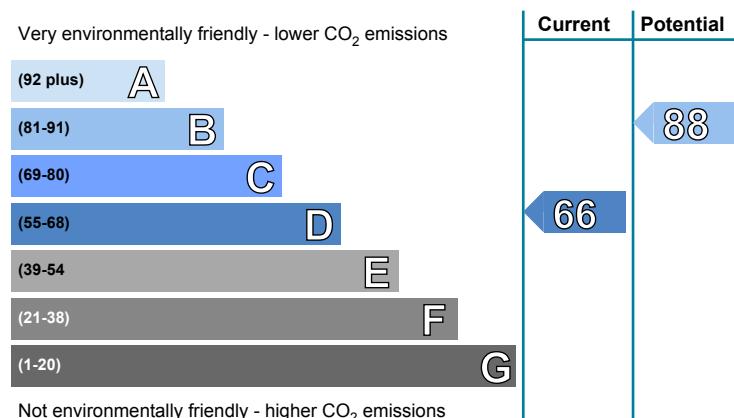

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£375.00
2 Floor insulation (suspended floor)	£800 - £1,200	£207.00
3 Low energy lighting	£20	£66.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 270 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 69% of fixed outlets	★★★★☆	★★★★☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 45 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,445 over 3 years	£1,872 over 3 years	
Hot water	£507 over 3 years	£339 over 3 years	
Lighting	£324 over 3 years	£249 over 3 years	
<b>Totals</b>	<b>£3,276</b>	<b>£2,460</b>	 You could save £816 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£500 - £1,500	£125	 C 71	 C 71
2 Floor insulation (suspended floor)	£800 - £1,200	£69	 C 73	 C 74
3 Low energy lighting for all fixed outlets	£20	£22	 C 74	 C 74
4 Solar water heating	£4,000 - £6,000	£57	 C 75	 C 76
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£507	 B 88	 B 88

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

**energy**  
saving  
trust®

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,969	N/A	(1,351)	N/A
Water heating (kWh per year)	1,834			

## Addendum

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK ([www.ecmk.co.uk](http://www.ecmk.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Alan Hudson
Assessor membership number:	ECMK302881
Company name/trading name:	Walker Fraser Steele
Address:	27 WATERLOO STREET GLASGOW G2 6BZ
Phone number:	07801301462
Email address:	<a href="mailto:alan.hudson@walkerfrasersteele.co.uk">alan.hudson@walkerfrasersteele.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSOTLAND.ORG  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



Scottish Single Survey



# Single Survey

survey report on:

<b>Property address</b>	162 STANMORE ROAD GLASGOW G42 9AP
<b>Customer</b>	Ms J Moffat
<b>Customer address</b>	
<b>Prepared by</b>	Walker Fraser Steele
<b>Date of inspection</b>	12th June 2024

**Walker Fraser Steele**  
**Chartered Surveyors**

## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

# Terms and Conditions

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

# Terms and Conditions

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

# Terms and Conditions

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

# Single Survey

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	The subjects comprise a mid terraced house with accommodation arranged over two levels.
<b>Accommodation</b>	Ground Floor - Entrance Hall, Living Room and Kitchen.  First Floor - Landing, Two Bedrooms and a Bathroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	58 sq.m.
<b>Neighbourhood and location</b>	The property is located in the Mount Florida area of Glasgow where there is a mix of residential housing types. There is a wide range of residential amenities available in the surrounding area and public transport connections with the City Centre are readily available.
<b>Age</b>	The property is estimated to be approximately 55/60 years old.
<b>Weather</b>	At the time of our inspection, it was dry.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where appropriate.</b>  There is a single rendered brick chimney that appears to be shared with the adjoining property to the right. The chimney incorporates lead flashings.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b>  <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b>  <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b>

# Single Survey

	<p>The roof is of a traditional pitched timber frame design overlaid with concrete tiles on timber sarking boards.</p> <p>We would point out that due to the configuration of the site, it has not been possible to inspect the rear roof slope and we are therefore unable to comment on the condition of this area.</p> <p>Our inspection of the loft area has been restricted by the presence of insulating materials.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Gutters are formed with plastic fittings whilst the downpipes are formed with the original cast-iron fittings.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The outer walls are of cavity brick construction, roughcasted externally and plastered on hard internally.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows are formed with uPVC framed double glazed units.</p> <p>Both the front and rear entrance doors comprise single leaf uPVC framed double glazed units.</p> <p>It appears that soffits and fascias are formed with uPVC weatherboard.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>Cast-iron fittings are painted.</p>
<b>Conservatories / porches</b>	Not applicable.
<b>Communal areas</b>	Not applicable.

# Single Survey

<b>Garages and permanent outbuildings</b>	Not applicable.
<b>Outside areas and boundaries</b>	<p><b>Visually inspected.</b></p> <p>The front garden has been laid with gravel and a concrete paving slab path. Boundaries at the front are formed with timber fencing and metal railings.</p> <p>The rear garden slopes steeply down from the house. It has been formed into various terraces. There is a mixture of surfaces including timber decking, artificial turf, gravel and a concrete hard standing on the lower terrace. It would be possible to park a car in this area, but we note that the access lane to the rear is poorly surfaced. Rights of access over the lane should be confirmed by reference to the Title Deeds.</p> <p>Boundaries to the rear are formed with brick walls and timber fences. The retaining walls forming the various terraces also comprise masonry structures.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level.</b></p> <p>Ceilings are formed in plasterboard.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level.</b></p> <p><b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Partitions are of solid brick construction, plastered on hard.</p>
<b>Floors including sub floors</b>	<p><b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>Floors are of suspended timber construction throughout.</p> <p>Our inspection of floor surfaces has been limited by the presence of floor coverings and some furnishings. It has not been possible to inspect the sub-floor area.</p>
<b>Internal joinery and kitchen fittings</b>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>There is a range of doors, door facings and skirting boards throughout.</p>


# Single Survey

	<p>The kitchen contains a range of wall mounted and base units.</p>
<b>Chimney breasts and fireplaces</b>	<p><b>Visually inspected.</b></p> <p><b>No testing of the flues or fittings was carried out.</b></p> <p>The original fireplace has been removed from the living room, but the chimneybreast remains intact.</p>
<b>Internal decorations</b>	<p><b>Visually inspected.</b></p> <p>Internal surfaces have been papered and painted. Ceramic tiles have also been utilised.</p>
<b>Cellars</b>	Not applicable.
<b>Electricity</b>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p> <p>The meter and consumer unit are located in the under-stair cupboard.</p>
<b>Gas</b>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b></p> <p>Mains supply.</p> <p>The meter is located in an external meter box to the front of the property.</p>
<b>Water, plumbing, bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains supply.</p> <p>Visible pipework is formed in copper and plastic fittings.</p> <p>The bathroom contains a sanitary suite comprising; bath with mixer shower attachment, wash hand basin and WC.</p>

# Single Survey

<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a gas fired central heating system that incorporates water filled radiators. The boiler is located in a cupboard at the front bedroom and is vented by means of a fan-assisted flue.</p> <p>Hot water is also provided by the central heating system.</p>
<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>It is assumed that the drains are connected to the public sewer.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>For both new and existing homes, from February 2022 The Fire and Smoke Alarm Standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. You can obtain further details from the Scottish Government web site <a href="http://www.mygov.scot">www.mygov.scot</a> (search Smoke Alarm).</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>At the time of inspection, the property was part furnished and floor coverings were in place throughout.</p> <p>Our inspection of the loft area is limited by the presence of a thick layer of insulation material.</p> <p>It has not been possible to inspect the rear roof slope due to the configuration of the site.</p>

## Sectional Diagram showing elements of a typical house

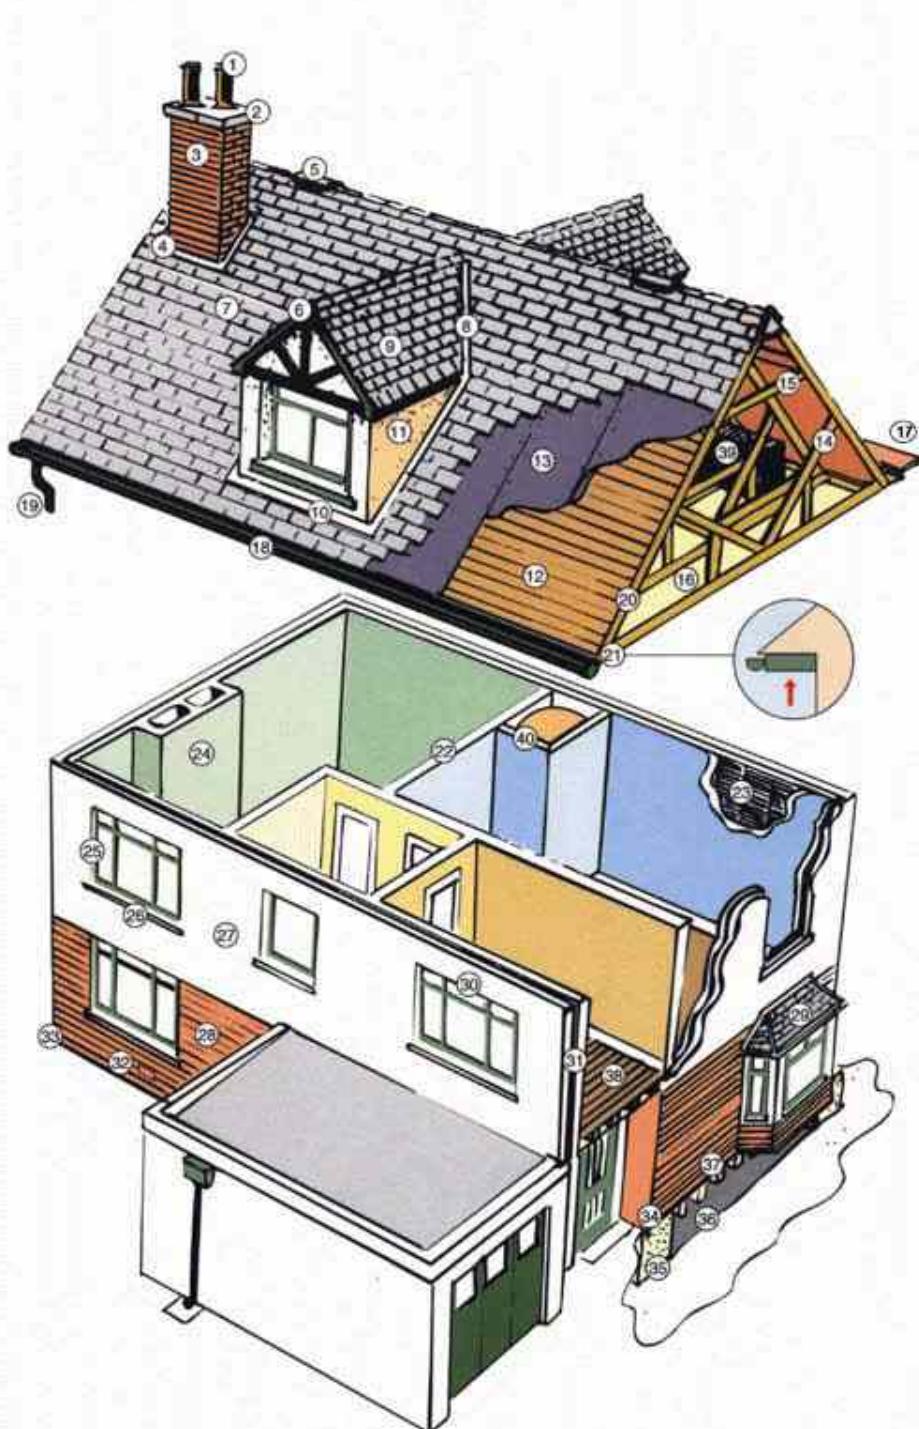

- 1 Chimney pots
- 2 Coping stone
- 3 Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11 Dormer cheeks
- 12 Sarking
- 13 Roof felt
- 14 Trusses
- 15 Collar
- 16 Insulation
- 17 Parapet gutter
- 18 Eaves guttering
- 19 Rainwater downpipe
- 20 Verge boards /skews
- 21 Soffit boards
- 22 Partition wall
- 23 Lath / plaster
- 24 Chimney breast
- 25 Window pointing
- 26 Window sills
- 27 Rendering
- 28 Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- 31 Cavity walls / wall ties
- 32 Subfloor ventilator
- 33 Damp proof course
- 34 Base course
- 35 Foundations
- 36 Solum
- 37 Floor joists
- 38 Floorboards
- 39 Water tank
- 40 Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

# Single Survey

## 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	No obvious evidence of structural movement was noted.

 Dampness, rot and infestation	
Repair category	1
Notes	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

 Chimney stacks	
Repair category	1
Notes	No obvious issues noted.

 Roofing including roof space	
Repair category	1
Notes	<p>It appears that the roof tiles have been renewed relatively recently and as a consequence the roof is noted to be in a good condition.</p> <p>Our inspection of the loft area was restricted by the presence of insulating materials, but it is noted that the sarking boards have also been replaced.</p>

 Rainwater fittings	
Repair category	1
Notes	There are no significant issues to report.

# Single Survey

 Main walls	
Repair category	1
Notes	<p>The outer walls are in a condition that is consistent with age and type of construction.</p> <p>There are several hairline cracks noted in the roughcast, but these appear to be superficial in nature and do not represent a structural issue.</p>
 Windows, external doors and joinery	
Repair category	1
Notes	Double glazed windows and doors have been maintained in acceptable condition.
 External decorations	
Repair category	1
Notes	Paint work to cast-iron fittings is generally acceptable although some minor rust staining is noted.
 Conservatories/porches	
Repair category	-
Notes	Not applicable.
 Communal areas	
Repair category	-
Notes	Not applicable
 Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.
 Outside areas and boundaries	
Repair category	1
Notes	The garden areas have been adequately maintained.

# Single Survey

 Ceilings	
Repair category	1
Notes	No obvious issues to report.
 Internal walls	
Repair category	1
Notes	No issues noted.
 Floors including sub-floors	
Repair category	1
Notes	Floors are noted to be level and even throughout.
 Internal joinery and kitchen fittings	
Repair category	1
Notes	Internal joinery fittings have been adequately maintained. Kitchen units exhibit wear and tear that is consistent with normal use.
 Chimney breasts and fireplaces	
Repair category	1
Notes	There are no issues noted at the chimney breast.
 Internal decorations	
Repair category	1
Notes	The standard of internal decorations is satisfactory.
 Cellars	
Repair category	-
Notes	Not applicable.

# Single Survey

 Electricity	
<b>Repair category</b>	1
<b>Notes</b>	<p>It should be noted that the electrical installation has not been tested as this is outside the remit of this inspection. However, it would be prudent to follow guidance set out by the Institute of Electrical Engineers advising that a domestic electrical installation should undergo a safety test every 5 years or at a change of ownership.</p>
 Gas	
<b>Repair category</b>	1
<b>Notes</b>	<p>There has been no test of the gas installation as this is not in our remit for this type of inspection. No obvious issues have been noted but it would be prudent to arrange for a gas safety test to be carried out in early course and then yearly thereafter.</p>
 Water, plumbing and bathroom fittings	
<b>Repair category</b>	1
<b>Notes</b>	<p>There are no obvious issues noted to be affecting visible plumbing apparatus. The bathroom suite has a modern appearance and has been adequately maintained.</p>
 Heating and hot water	
<b>Repair category</b>	1
<b>Notes</b>	<p>The central heating system has not been tested as this is outside the scope of this inspection.</p> <p>Although no obvious issues have been noted, it would be prudent to have the central heating boiler serviced in early course as a precaution.</p> <p>Heating and hot water systems should be serviced annually by an appropriately qualified contractor to ensure the system remain safe and fully functional.</p>
 Drainage	
<b>Repair category</b>	1
<b>Notes</b>	<p>There are no obvious issues noted that relate to the foul or surface water drainage systems.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3	
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	
Category 2	
Repairs or replacement requiring future attention, but estimates are still advised.	
Category 1	
No immediate action or repair is needed.	
Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

## Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First	
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>

# Single Survey

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

It is assumed that the roads and footpaths bounding the property have been adopted and are maintained by the Local Authority.

It is assumed that the property is held in 'Absolute Ownership' and is unaffected by any onerous Title restrictions or burdens.

### Estimated reinstatement cost for insurance purposes

£135000 (One Hundred and Thirty Five Thousand Pounds)

### Valuation and market comments

£185000 (One Hundred and Eighty Five Thousand Pounds)

The valuation reflects the current condition of the property. Prevailing market conditions in the local area have also been considered.

<b>Signed</b>	Security Print Code [435211 = 5086 ] Electronically signed
<b>Report author</b>	Alan Hudson
<b>Company name</b>	Walker Fraser Steele
<b>Address</b>	1st Floor, Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ
<b>Date of report</b>	15th June 2024

# Mortgage Valuation Report

## Walker Fraser Steele Chartered Surveyors

### Property Address

Address 162 STANMORE ROAD, GLASGOW, G42 9AP  
Seller's Name Ms J Moffat  
Date of Inspection 12th June 2024

### Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector,  
e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

### Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

### Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

### Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

None.

# Mortgage Valuation Report

## Construction

Walls	<input checked="" type="checkbox"/> Brick	<input type="checkbox"/> Stone	<input type="checkbox"/> Concrete	<input type="checkbox"/> Timber frame	<input type="checkbox"/> Other (specify in General Remarks)
Roof	<input checked="" type="checkbox"/> Tile	<input type="checkbox"/> Slate	<input type="checkbox"/> Asphalt	<input type="checkbox"/> Felt	<input type="checkbox"/> Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None	Water	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None
Electricity	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None	Gas	<input checked="" type="checkbox"/> Mains	<input type="checkbox"/> Private	<input type="checkbox"/> None
Central Heating	<input checked="" type="checkbox"/> Yes	<input type="checkbox"/> Partial	<input type="checkbox"/> None				

Brief description of Central Heating:

Gas fired boiler supplying water filled radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

<input type="checkbox"/> Rights of way	<input type="checkbox"/> Shared drives / access	<input type="checkbox"/> Garage or other amenities on separate site	<input type="checkbox"/> Shared service connections
<input type="checkbox"/> Ill-defined boundaries	<input type="checkbox"/> Agricultural land included with property		<input type="checkbox"/> Other (specify in General Remarks)

## Location

<input type="checkbox"/> Residential suburb	<input checked="" type="checkbox"/> Residential within town / city	<input type="checkbox"/> Mixed residential / commercial	<input type="checkbox"/> Mainly commercial
<input type="checkbox"/> Commuter village	<input type="checkbox"/> Remote village	<input type="checkbox"/> Isolated rural property	<input type="checkbox"/> Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

<input type="checkbox"/> Made up road	<input type="checkbox"/> Unmade road	<input type="checkbox"/> Partly completed new road	<input type="checkbox"/> Pedestrian access only	<input checked="" type="checkbox"/> Adopted	<input type="checkbox"/> Unadopted
---------------------------------------	--------------------------------------	--	---	---	------------------------------------

# Mortgage Valuation Report

## General Remarks

The subjects comprise a mid terraced house with accommodation arranged over two levels.

The property is located in the Mount Florida area of Glasgow.

The property has been maintained in acceptable condition and there are no significant defects to report.

## Essential Repairs

None.

Estimated cost of essential repairs £

Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

In our opinion the subjects would form suitable mortgage security by a lending institution.

## Valuations

Market value in present condition	£ <input type="text" value="185000"/>
Market value on completion of essential repairs	£ <input type="text"/>
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ <input type="text" value="135000"/>
Is a reinspection necessary?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed	Security Print Code [435211 = 5086 ]
	Electronically signed by:-
Surveyor's name	Alan Hudson
Professional qualifications	MRICS
Company name	Walker Fraser Steele
Address	1st Floor, Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ
Telephone	0141 221 0442
Fax	0141 258 5976
Report date	15th June 2024

## **Sellers Property Questionnaire**



# Property Questionnaire

**Property address**

162 STANMORE ROAD,  
GLASGOW,  
G42 9AP

**Seller(s)**

Janette Moffat

**Completion date of property questionnaire**

10 June 2024

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	<b>How long have you owned the property?</b> 13 years 3 months	
2.	<b>Council tax</b>	
	<b>Which Council Tax band is your property in? (Please circle)</b> A      B      C <b>D</b> E      F      G      H	
3.	<b>Parking</b>	
	<b>What are the arrangements for parking at your property?</b> <b>(Please tick all that apply)</b> <ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input checked="" type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	<b>Conservation area</b>	
	<b>Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?</b>	<b>Yes / No / Don't know</b>

# Property Questionnaire

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  <u>If you have answered yes, please describe below the changes which you have made:</u>	Yes / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  <u>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</u>  <u>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</u>	Yes / No
	Have you had replacement windows, doors, patio doors or double glazing installed in your property?  <u>If you have answered yes, please answer the three questions below:</u>	Yes / No
(i) Were the replacements the same shape and type as the ones you replaced?  (ii) Did this work involve any changes to the window or door openings?	Yes / No	
	Yes / No	
	(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):  Old local authority type windows removed and replaced with more modern standard type windows. Work done at front approx 2012, back done approx 2013. Guarantee was for 10 years and has now expired.  <u>Please give any guarantees which you received for this work to your solicitor or estate agent.</u>	

# Property Questionnaire

7.	<b>Central heating</b>	
a.	<p><b>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</b></p> <p><b>If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</b></p> <p>Gas central heating</p> <p><b>If you have answered yes, please answer the three questions below:</b></p>	Yes / No / Partial
b.	<b>When was your central heating system or partial central heating system installed?</b>	Unknown- was in the property when I bought it.
c.	<p><b>Do you have a maintenance contract for the central heating system?</b></p> <p><b>If you have answered yes, please give details of the company with which you have a maintenance contract:</b></p> <p>Scottish Power have the contract for boiler maintenance which also includes central heating breakdown if the boiler breaks down. If the heating failed for some other reason it would not be covered by this contract.</p>	Yes / No
d.	<b>When was your maintenance agreement last renewed? (Please provide the month and year).</b>	Feb 2024 - boiler service has been arranged for 20 Ju
8.	<b>Energy Performance Certificate</b>	
	<b>Does your property have an Energy Performance Certificate which is less than 10 years old?</b>	Yes / No
9.	<b>Issues that may have affected your property</b>	
a.	<p><b>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</b></p> <p><b>If you have answered yes, is the damage the subject of any outstanding insurance claim?</b></p>	Yes / No
b.	<p><b>Are you aware of the existence of asbestos in your property?</b></p> <p><b>If you have answered yes, please give details:</b></p>	Yes / No

# Property Questionnaire

10.	Services																										
a.	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="background-color: #e0e0e0;">Services</th> <th style="background-color: #e0e0e0;">Connected</th> <th style="background-color: #e0e0e0;">Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td style="text-align: center;">✓</td> <td>EDF</td> </tr> <tr> <td>Water mains / private water supply</td> <td style="text-align: center;">✓</td> <td>Scottish Water</td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">✓</td> <td>EDF</td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">✓</td> <td>Scottish Water</td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">—</td> <td></td> </tr> <tr> <td>Cable TV / satellite</td> <td style="text-align: center;">—</td> <td></td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">✓</td> <td>EE</td> </tr> </tbody> </table>			Services	Connected	Supplier	Gas / liquid petroleum gas	✓	EDF	Water mains / private water supply	✓	Scottish Water	Electricity	✓	EDF	Mains drainage	✓	Scottish Water	Telephone	—		Cable TV / satellite	—		Broadband	✓	EE
	Services	Connected	Supplier																								
	Gas / liquid petroleum gas	✓	EDF																								
	Water mains / private water supply	✓	Scottish Water																								
	Electricity	✓	EDF																								
	Mains drainage	✓	Scottish Water																								
	Telephone	—																									
	Cable TV / satellite	—																									
Broadband	✓	EE																									
b.	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes, please answer the two questions below:</u></p>																										
			<del>Yes / No</del>																								
c.	<p>(i) Do you have appropriate consents for the discharge from your septic tank?</p>		<del>Yes / No / Don't know</del>																								
d.	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes, please give details of the company with which you have a maintenance contract:</u></p>		<del>Yes / No</del>																								

# Property Questionnaire

<b>11. Responsibilities for Shared or Common Areas</b>		
a.	<p><b>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</b></p> <p><b>If you have answered yes, please give details:</b></p>	<b>Yes / No / Don't Know</b>
b.	<p><b>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</b></p> <p><b>If you have answered yes, please give details:</b></p>	<b>Yes / No / Not applicable</b>
c.	<b>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</b>	<b>Yes / No</b>
d.	<p><b>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</b></p> <p><b>If you have answered yes, please give details:</b></p>	<b>Yes / No</b>
e.	<p><b>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</b></p> <p><b>If you have answered yes, please give details:</b></p>	<b>Yes / No</b>
f.	<p><b>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</b></p> <p><b>If you have answered yes, please give details:</b></p>	<b>Yes / No</b>
<b>12. Charges associated with your property</b>		
a.	<p><b>Is there a factor or property manager for your property?</b></p> <p><b>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</b></p>	<b>Yes / No</b>

# Property Questionnaire

b.	<p><b>Is there a common buildings insurance policy?</b></p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes / No / Don't Know</del></p> <p><del>Yes / No / Don't Know</del></p>
c.	<p><b>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</b></p>	
13.	<p><b>Specialist works</b></p>	
a.	<p><b>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</b></p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p><del>Yes / No</del></p>
b.	<p><b>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</b></p> <p>If you have answered yes, please give details:</p>	<p><del>Yes / No</del></p>
c.	<p><b>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</b></p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p><del>Yes / No</del></p>

# Property Questionnaire

<b>14. Guarantees</b>								
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>							
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*	
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>  New roof installed September 2023 - guaranteed for 10 years. Cavity wall insulation installed 2011 but I can't find the paperwork for it.							
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b>  <u>If you have answered yes, please give details:</u>						<b>Yes / No</b>	
<b>15. Boundaries</b>								
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b>  <u>If you have answered yes, please give details:</u>						<b>Yes / No / Don't know</b>	

# Property Questionnaire

16.	Notices that affect your property	
	<b>In the past 3 years have you ever received a notice:</b>	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>Yes</del> / No / <del>Don't know</del>
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
c.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Don't know</del>
	<b>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): \_\_\_\_\_

Date: \_\_\_\_\_





Walker Fraser Steele, a trading name of e.surv Ltd.  
Lahnstein House, Gold Street, Kettering, Northants, NN16 8AP.  
Registered in England, Company No: 2264161. Regulated by RICS



the mark of  
property  
professionalism  
worldwide